

Imray Correction Notice

18 September 2018

ICA141

Chart A141 WGS 84

Edition 2001

Versions available:

New Edition (Corrected to April 2001)

NOTE Below is a complete list of corrections issued since the 2001 edition of this chart was published. Corrections are listed chronologically in ascending order.

1 Puerto Rico, Sonda de Vieques, E of Bajo Chinchorro del Sur

Delete Lt buoys: G can 1 Fl.G.6s in 18°13'·46N 65°28'·1W and R con 2 Fl.R in 18°13'·07N 65°28'·7W.

Pasaje de Vieques

Delete Lt buoys: 6 Fl.R.2·5s in 18°10'·65N 65°36'·94W and G con 3 Fl.G.2·5s in 18°09'·72N 65°37'·57W.

Isla de Vieques, Radas Roosevelt

Delete R con Lt buoy 10 Fl.R.4s in 18°10'·06N 65°33'·14W (ILNW 296/04)

2 Puerto Rico

Delete Ldg Lts: Iso.6s142ft on Pta Puerca; Q.70ft on Islas Cabritas and Idg line with Igd Ldg Lts 025° 24'(True) (ILNW 120/05)

3 Pasaje de Vieques

Delete G can Lt buoys:

No.1 Fl.G.6s in 18°11'·8N 65°36'·6W

No.11 Fl.G.4s in 5°11'·3N 65°34'·9W (ILNW 514/05)

4 Bahía de Fajardo

Insert marina symbol, plus associated legend *Sunbay Marina*, in 18°20'·4N 65°38'·0E. (ILNW 168/09)

5 Isla de Vieques, Pta Arenas northwards (buoy removed - see ILNW 388/12)

Insert G pillar Lt buoy No11 Fl.G.4s in 18°11'·35N 65°34'·90W (ILNW 5/12)

6 Isla de Vieques, Pta Arenas northwards

Delete G pillar Lt buoy No11 Fl.G.4s in 18°11'·32N 65°34'·91W (ILNW 388/12)

7 Ensenada Honda

Delete Lts:

Iso.6s66ft in 18°13'·97N 65°38'·38W

Q.36ft in 18°13'·69N 65°38'·08W

Delete assoc. Idg line. (ILNW 207/13)

8 Bajo Hodgkins eastwards

Insert Y spher Lt buoy E Fl.Y.4s in 18°15'·57N 65°27'·41W (ILNW 424/13)

9 Cabo San Juan

Amend range of Lt to 11M in 18°22'·9N 65°37'·1W (ILNW 39/16)

10 CAUTION – AIDS TO NAVIGATION

The buoyage in Puerto Rico, and the Spanish and US Virgin Islands is well laid out. However, the USCG buoy tender only comes down to check, repair and replace buoys and lights every six months. There is no local authority that maintains or replaces missing buoys. If a buoy goes adrift or a light goes out one month after the buoy tenders trip, it will not be replaced or repaired for five months. Thus the buoyage on this chart cannot be regarded as absolutely reliable. (ILNW 641/17)

11 NOTICE TO MARINERS

This chart is no longer supported with notice to mariner corrections. No future notice to mariner corrections will be issued against this chart. (ILNW 465/18)

Corrections to notes on the chart reverse

MARINA PUERTO CHICO

Add new section below:

SUN BAY MARINA

Sun Bay Marina was established in 2005/6.

It is said that this is an excellent marina with 282 berths for boats up to 60ft in length and with up to 7ft draft. The marina offers all the normal services of a first class marina and is within walking distance of the

village of Fajardo. The main town of Fajardo, meanwhile, is a taxi ride away.
There appear to be 7ft in the outer slip, with the basin shallowing as you get further in. The marina is normally full of Puerto Rican power boats leaving little room for visiting yachts except at weekends when the local boats disappear to neighboring islands
Before entering contact via VHF Ch 16, tel: 787 863 5282/863 0313. (ILNW 168/09)