

Imray Correction Notice

ICY2-2SF

15 April 2025

Chart Y2^{WGS 84}

Edition 2022

Versions available:

New Edition (corrected to September 2022)

Update (corrected to April 2023)

Update (corrected to February 2024)

NOTES

Below is a complete list of corrections issued since the 2022 edition of this chart was published.

Each correction is issued with an ILNW reference number and year.

Corrections are listed chronologically in ascending order.

For Update versions of this chart, please check the bottom left corner of the chart to determine the last applied correction.

Any further corrections will be applicable from that point onwards.

1 Aldeburgh Ridge

Insert depth 2.3m and extend 5m contour to enclose in 52°07'·74N 1°37'·69E. Delete depth 3.5m close NW (ILNW 460/22)

2 Orford Haven *(correction amended see ILNW 221/24)*

For detailed information about the River Ore entrance consult the accompanying chartlet (survey 02/23). For further details regarding the latest pilotage information of this area see www.eastcoastpilot.com (ILNW 116/23)

3 Aldeburgh Ridge

Insert depth 0.9m in 52°06'·84N 1°36'·83E. Extend contour to enclose (ILNW 288/23)

4 Orford Haven *(correction amended see ILNW 49/25)*

Move:

R can buoy **Oxley** to 52°02'·07N 1°27'·70E

For detailed information about the River Ore entrance consult the accompanying chartlet (survey 04/24). For further details regarding the latest pilotage information and aerial photography of this area see www.eastcoastpilot.com (ILNW 221/24)

5 Whiting Bank

Insert depth:

4.2m in 52°01'·40N 1°31'·05E and extend 5m contour S to enclose. Delete depth 7.6m close SE

4.4m in 52°03'·63N 1°33'·26E and extend 5m contour NE to enclose. Delete depth 6.8m close NE (ILNW 498/24)

6 Orford Haven

Move:

RW safe water buoy **Orford Haven** LFl.10s to 52°01'·84N 1°27'·98E

R can buoy **Oxley** to 52°02'·05N 1°27'·60E

G con buoy **Weir** to 52°02'·19N 1°27'·57E

For detailed information about the River Ore entrance consult the accompanying chartlet (survey 03/25). For further details regarding the latest pilotage information and aerial photography of this area see www.eastcoastpilot.com (ILNW 49/25)

Caution

This chart is not to be used for navigation. It is based on a survey made by Trinity House on 1st March 2025. Users are reminded that depths are subject to constant change and consequently this chart should be used with extreme caution as the situation is likely to be different from the one depicted on the date of the survey.

Neither Trinity House nor the publisher will accept any liability for loss, injury or damage incurred by misuse of the data in this chart. Navigators are advised to seek confirmation of the latest situation before attempting to enter the river from the ECP Honorary Port Pilot and Orford Harbourmaster Matt Smy ☎ 07528 092635, or call *Chantry* on VHF Ch 08 (although note that he is based at Orford and may be out of radio range from the river entrance).

Soundings in metres at Lowest Astronomical Tide (LAT). Positions are referred to WGS84 datum.

Imray Laurie Norie & Wilson Ltd.
www.imray.com

© British Crown Copyright, 2025.

All rights reserved.



52°03'N


Depths in Metres

This chart is a
free download

**NOT TO BE USED
FOR NAVIGATION**

Buoy Positions for 2025

Orford Haven	52°01'·840N 01°27'·980E
Oxley	52°02'·054N 01°27'·604E
Weir	52°02'·188N 01°27'·574E

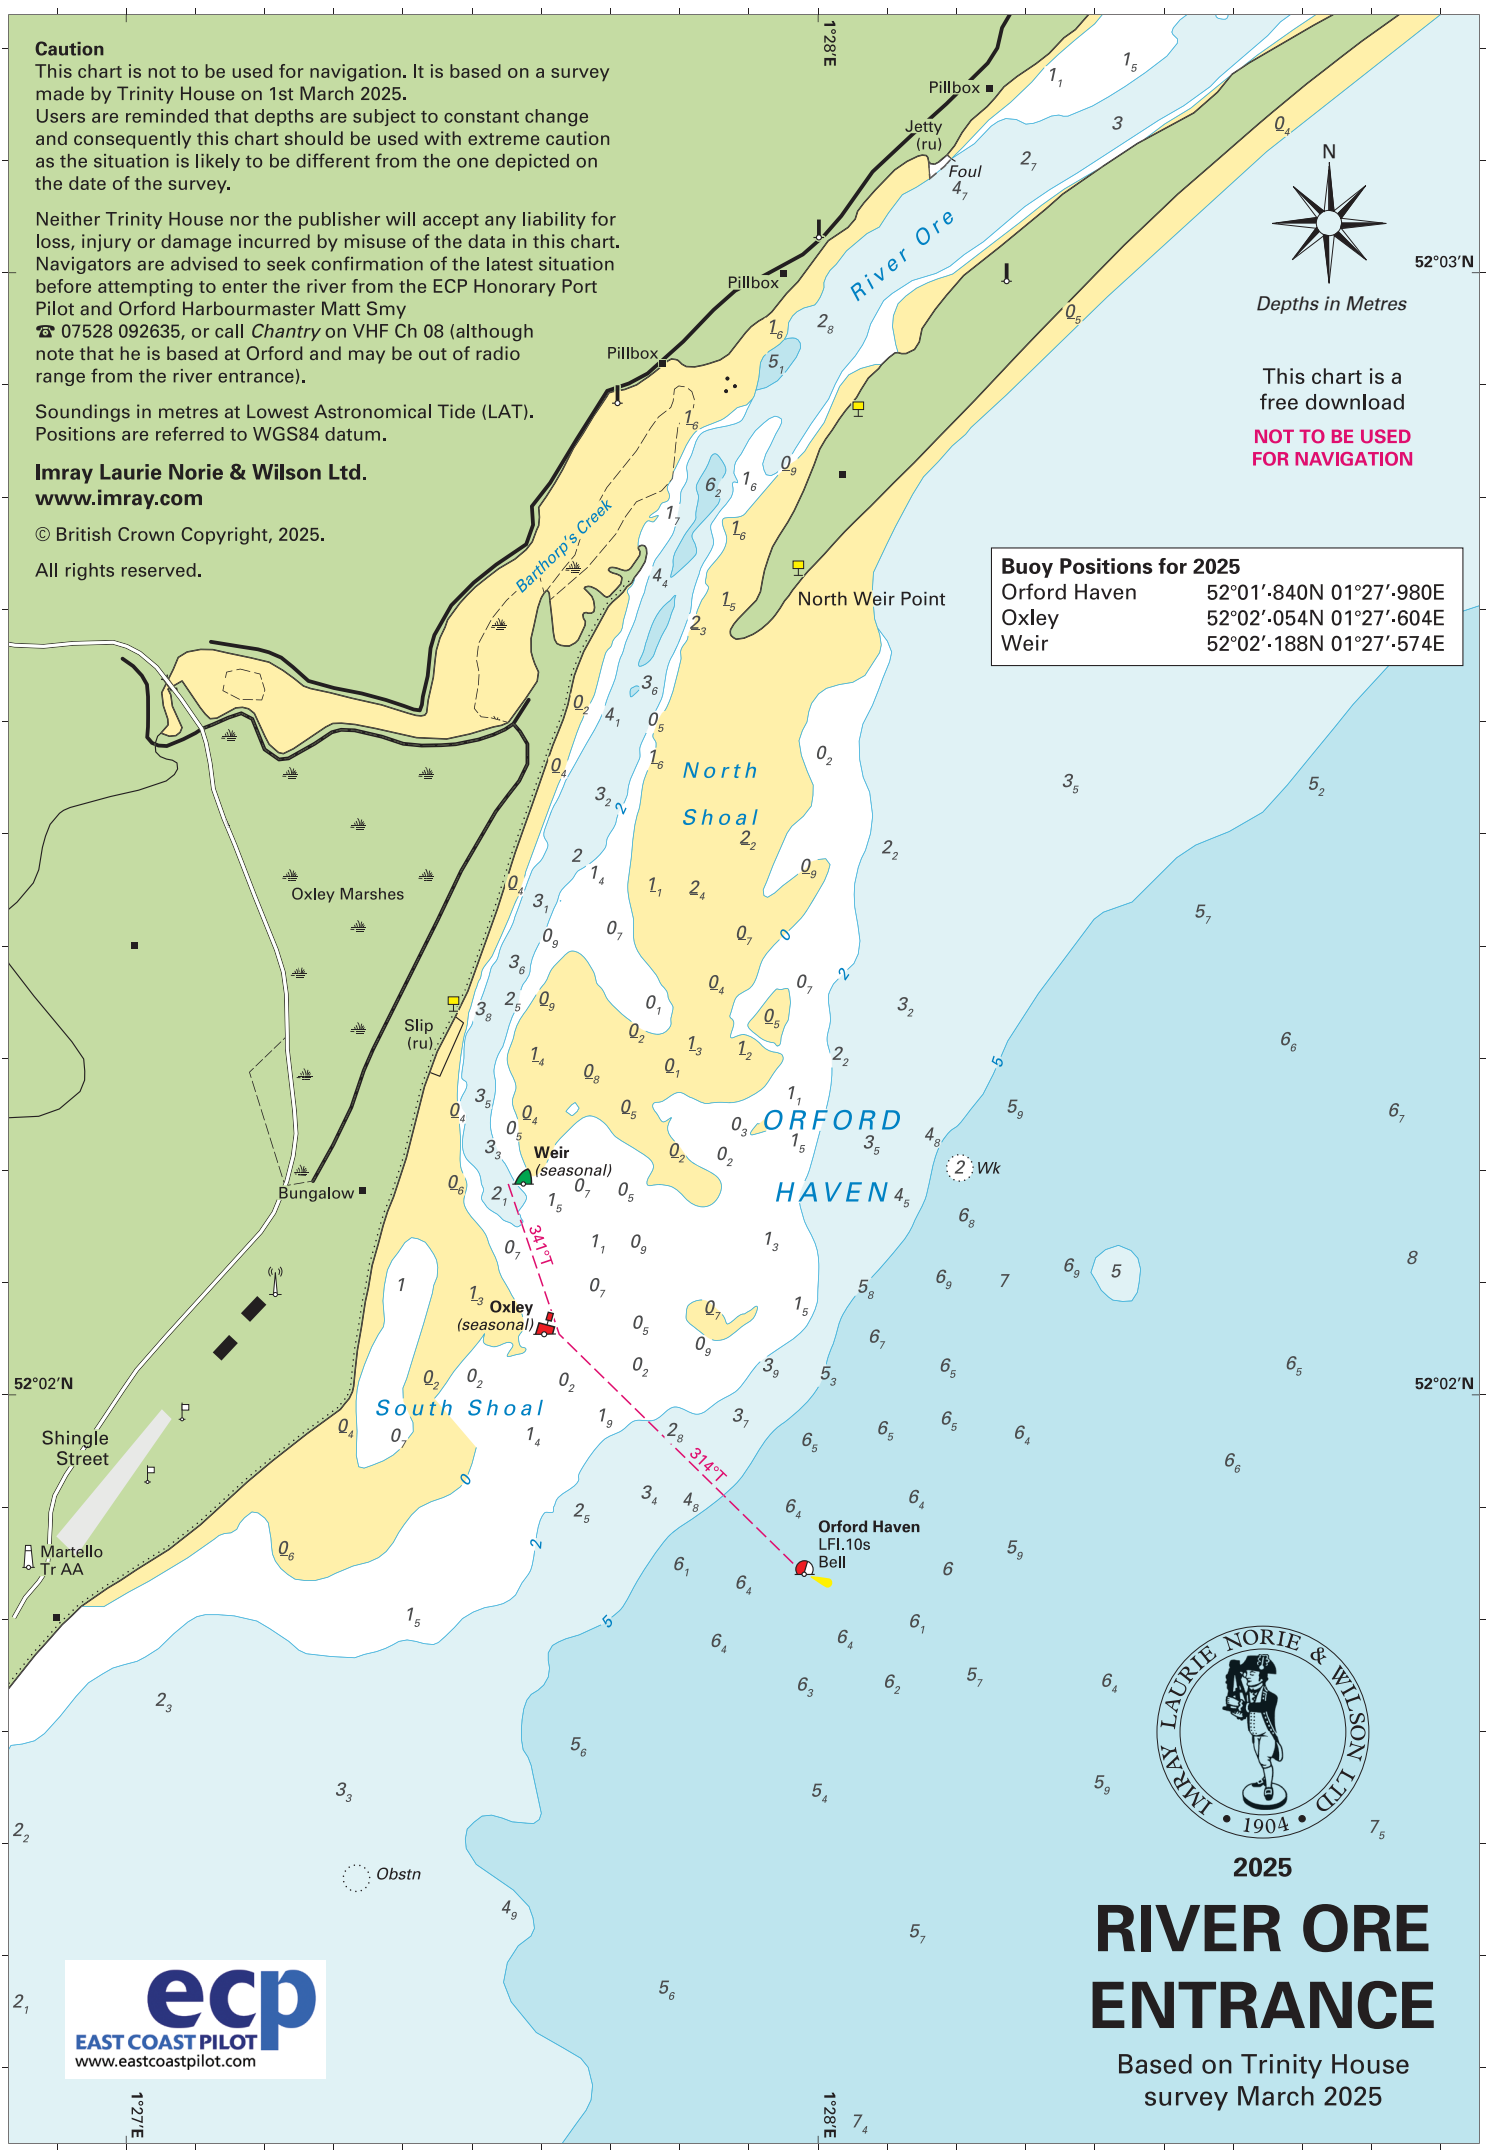

2025

RIVER ORE ENTRANCE

Based on Trinity House
survey March 2025

eCP
EAST COAST PILOT
www.eastcoastpilot.com